


Energy rating and score

This property's energy rating is D. It has the potential to be D.

See how to improve this property's energy efficiency.

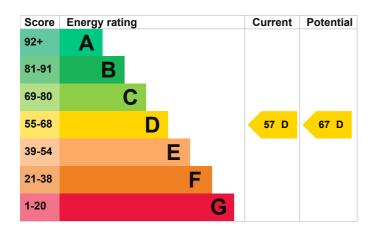

The graph shows this property's current and potential energy rating.

Properties get a rating from A (best) to G (worst) and a score. The better the rating and score, the lower your energy bills are likely to be.

For properties in Northern Ireland:

the average energy rating is D the average energy score is 60

Breakdown of property's energy performance

Features in this property

Features get a rating from very good to very poor, based on how energy efficient they are. Ratings are not based on how well features work or their condition.

Assumed ratings are based on the property's age and type. They are used for features the assessor could not inspect.

Feature	Description	Rating
Wall	Solid brick, as built, no insulation (assumed)	Very poor
Wall	Cavity wall, as built, insulated (assumed)	Good
Roof	Flat, insulated (assumed)	Average
Roof	Roof room(s), no insulation (assumed)	Very poor
Window	Fully double glazed	Average
Main heating	Boiler and radiators, mains gas	Good
Main heating control	Programmer, room thermostat and TRVs	Good
Hot water	From main system	Good
Lighting	Low energy lighting in 79% of fixed outlets	Very good
Floor	Solid, no insulation (assumed)	N/A
Secondary heating	Room heaters, mains gas	N/A

Primary energy use

The primary energy use for this property per year is 308 kilowatt hours per square metre (kWh/m2).

How this affects your energy bills

An average household would need to spend £1,115 per year on heating, hot water and lighting in this property. These costs usually make up the majority of your energy bills.

You could save £274 per year if you complete the suggested steps for improving this property's energy rating.

This is **based on average costs in 2021** when this EPC was created. People living at the property may use different amounts of energy for heating, hot water and lighting.

Impact on the environment

This property's environmental impact rating is E. It has the potential to be D.

Properties get a rating from A (best) to G (worst) on how much carbon dioxide (CO2) they produce each year.

This property produces 5.5 tonnes of CO2 This property's potential 3.9 tonnes of CO2 production

You could improve this property's CO2 emissions by making the suggested changes. This will help to protect the environment.

These ratings are based on assumptions about average occupancy and energy use. People living at the property may use different amounts of energy.

Carbon emissions

An average household produces

6 tonnes of CO2

Steps you could take to save energy

Step	Typical installation cost	Typical yearly saving
1. Room-in-roof insulation	£1,500 - £2,700	£274
2. Floor insulation (solid floor)	£4,000 - £6,000	£33
3. Solar water heating	£4,000 - £6,000	£26
4. Internal or external wall insulation	£4,000 - £14,000	£146
5. Solar photovoltaic panels	£3,500 - £5,500	£332

Who to contact about this certificate

Contacting the assessor

Type of assessment

If you're unhappy about your property's energy assessment or certificate, you can complain to the assessor who created it.

Assessor's name	Adam Bolton
Telephone	07765554455
Email	adam bolton@hotmail.com

Contacting the accreditation scheme

If you're still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation scheme	Stroma Certification Ltd	
Assessor's ID	STRO032865	
Telephone	0330 124 9660	
Email	certification@stroma.com	
About this assessment		
Assessor's declaration	No related party	
Date of assessment	9 November 2021	
Date of certificate	10 November 2021	

RdSAP