

Energy performance certificate (EPC)

53, Killymeal Road DUNGANNON BT71 6LJ	Energy rating	Valid until: 4 June 2029
	F	Certificate number: 9251-0326-7810-5075-9902

Property type	Detached house
Total floor area	321 square metres

Energy rating and score

This property's energy rating is F. It has the potential to be D.


[See how to improve this property's energy efficiency.](#)

The graph shows this property's current and potential energy rating.

Properties get a rating from A (best) to G (worst) and a score. The better the rating and score, the lower your energy bills are likely to be.

For properties in Northern Ireland:

the average energy rating is D
the average energy score is 60

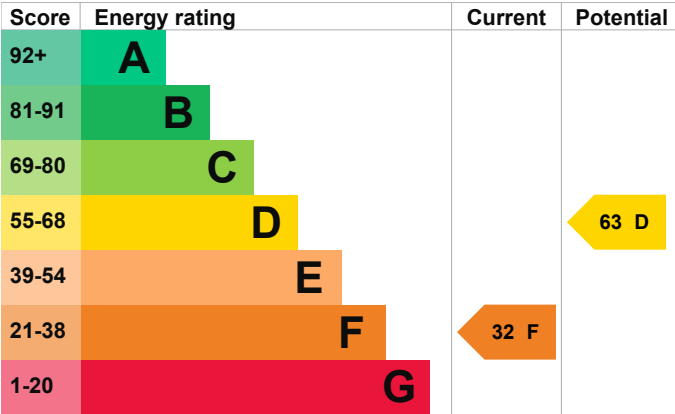

Breakdown of property's energy performance

Features in this property

Features get a rating from very good to very poor, based on how energy efficient they are. Ratings are not based on how well features work or their condition.

Assumed ratings are based on the property's age and type. They are used for features the assessor could not inspect.

Feature	Description	Rating
Wall	Cavity wall, as built, partial insulation (assumed)	Average
Roof	Pitched, no insulation	Very poor
Window	Fully double glazed	Average
Main heating	Boiler and radiators, oil	Average
Main heating control	Programmer, TRVs and bypass	Average
Hot water	From main system, no cylinder thermostat	Very poor
Lighting	Low energy lighting in 41% of fixed outlets	Average
Floor	Solid, no insulation (assumed)	N/A
Secondary heating	Room heaters, coal	N/A

Primary energy use

The primary energy use for this property per year is 297 kilowatt hours per square metre (kWh/m²).

Additional information

Additional information about this property:

- Cavity fill is recommended

How this affects your energy bills

An average household would need to spend **£3,670 per year on heating, hot water and lighting** in this property. These costs usually make up the majority of your energy bills.

You could **save £1,704 per year** if you complete the suggested steps for improving this property's energy rating.

This is **based on average costs in 2019** when this EPC was created. People living at the property may use different amounts of energy for heating, hot water and lighting.

Impact on the environment

This property's environmental impact rating is F. It has the potential to be E.

Properties get a rating from A (best) to G (worst) on how much carbon dioxide (CO₂) they produce each year.

Carbon emissions

An average household produces **6 tonnes of CO₂**

This property produces **27.0 tonnes of CO₂**

This property's potential production **14.0 tonnes of CO₂**

You could improve this property's CO₂ emissions by making the suggested changes. This will help to protect the environment.

These ratings are based on assumptions about average occupancy and energy use. People living at the property may use different amounts of energy.

Steps you could take to save energy

Step	Typical installation cost	Typical yearly saving
1. Increase loft insulation to 270 mm	£100 - £350	£983
2. Cavity wall insulation	£500 - £1,500	£400
3. Insulate hot water cylinder with 80 mm jacket	£15 - £30	£137
4. Low energy lighting	£95	£67
5. Replacement glazing units	£1,000 - £1,400	£117
6. Floor insulation (solid floor)	£4,000 - £6,000	£169
7. Solar water heating	£4,000 - £6,000	£66
8. Solar photovoltaic panels	£3,500 - £5,500	£286

Who to contact about this certificate

Contacting the assessor

If you're unhappy about your property's energy assessment or certificate, you can complain to the assessor who created it.

Assessor's name	Colm McGeown
Telephone	028 8772 7799
Email	colm@maneely.com

Contacting the accreditation scheme

If you're still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation scheme	Elmhurst Energy Systems Ltd
Assessor's ID	EES/004863
Telephone	01455 883 250
Email	enquiries@elmhurstenergy.co.uk

About this assessment

Assessor's declaration	No related party
Date of assessment	5 June 2019
Date of certificate	5 June 2019
Type of assessment	RdSAP